



DEPARTMENT OF THE ARMY
CAMP STANLEY STORAGE ACTIVITY, RRAD
25800 RALPH FAIR ROAD, BOERNE, TX 78015-4800

February 29, 2008

U-097-08

Public Works Administrator

7286 Dietz Elkhorn Rd.
Fair Oaks Ranch, TX 78015

RE: Sampling of water well FO-J1,
Located at Lot 29 Jackson Woods

Dear

Camp Stanley Storage Activity (CSSA) collected groundwater samples from your well (FO-J1) on 12/4/07. These samples were submitted to a laboratory contracted by CSSA's environmental contractor for volatile organic compound (VOC) analysis. This letter provides you with the VOC data from the laboratory results and a formal thank you for your assistance in this groundwater monitoring effort.

An abbreviated summary of analytical results compared to maximum contaminant levels (MCLs) allowed in drinking water by the U.S. EPA under the Safe Drinking Water Act is provided below:

Date Sampled	VOC Compound	Result (ppb)	MCL (ppb)
Well FO-J1, Located at Lot 29 Jackson Woods			
12/4/07	Tetrachloroethene (PCE)	0.05F	5
	Trichloroethene (TCE)	<0.05 (non-detect)	5
	<i>cis</i> -1,2-Dichloroethene (DCE)	<0.07 (non-detect)	70

*The "F" qualifier indicates the value is above the laboratory method detection limit, but below the laboratory reporting limit for the compound.


Based on the analytical data, low levels of the VOC PCE was identified in water samples from your well. These levels are below the applicable MCL and do not affect usability of your well. Results from the laboratory analysis are provided as an attachment for the event included in the summary table above.

As part of the ongoing CSSA environmental program, we are continuing to investigate and cleanup VOC source areas on the installation and to track these compounds in groundwater on- and off-post. As part of this effort, we may contact you in the future to schedule another sampling event for the well listed above.

Again, we would like to thank you for your cooperation. We remain committed to making sure your water is safe to use and keeping

you informed. If you have any questions concerning this letter, please contact me at 295-7416.

Sincerely,

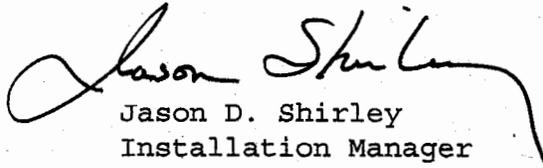

Jason D. Shirley
Installation Manager

Attachments

cc: Mr. Greg Lyssy, EPA Region 6
Mr. Sonny Rayos, TCEQ Central Office
Mr. Henry Karnei, TCEQ Region 13
Ms. Kyle Cunningham, San Antonio Metropolitan Health Dist.
Ms. Julie Burdey, Parsons
Ms. Samantha Elliott, Parsons

AFCEE
ORGANIC ANALYSES DATA SHEET 2
RESULTS

Analytical Method: EPA 8260B Preparatory Method: 5030B AAB #: 071216AC-118903
 Lab Name: APPL, Inc Contract #: W91278-06-D-0026/DY02
 Field Sample ID: FO-J1 Lab Sample ID: AX71633 Matrix: Water
 % Solids: NA Initial Calibration ID: C071215
 Date Received: 05-Dec-07 Date Prepared: 16-Dec-07 Date Analyzed: 16-Dec-07
 Concentration Units: ug/L

Analyte	MDL	RL	Concentration	Dilution	Confirm	Qualifier
1,1-DCE	0.12	1.2	0.12	1		U
Cis-1,2-DCE	0.07	1.2	0.07	1		U
TCE	0.05	1.0	0.05	1		U
Tetrachloroethene	0.06	1.4	0.14	1		F
Trans-1,2-DCE	0.08	0.6	0.08	1		U
Vinyl chloride	0.08	1.1	0.08	1		U

Surrogate	Recovery	Control Limits	Qualifier
1,2-DCA-D4(S)	107	69-139	
4-Bromofluorobenzene(S)	98.8	75-125	
Dibromofluoromethane(S)	106	75-125	
Toluene-D8(S)	100	75-125	

Internal Std	Qualifier
1,4-Dichlorobenzene-D(IS)	
Chlorobenzene-D5(IS)	
Fluorobenzene(IS)	

Comments:

ARF: 55042