



DEPARTMENT OF THE ARMY
CAMP STANLEY STORAGE ACTIVITY, MCAAP
25800 RALPH FAIR ROAD, BOERNE, TX 78015-4800

August 17, 2012

U-076-12

[REDACTED]
[REDACTED]
Boerne, TX 78015

SUBJECT: Sampling of Water Well RFR-10, Located at 25490 Old Fredericksburg Rd.

Dear [REDACTED]:

Camp Stanley Storage Activity (CSSA) collected a groundwater sample from your well (RFR-10) on 6/4/12. This sample was submitted to a laboratory contracted by CSSA's environmental contractor for volatile organic compound (VOC) analysis. This letter provides you with the VOC data from the laboratory results and a formal thank you for your assistance in this groundwater monitoring effort.

An abbreviated summary of analytical results compared to maximum contaminant levels (MCLs) allowed in drinking water by the U.S. EPA under the Safe Drinking Water Act is provided below:

Date Sampled	VOC Compound	Result (ppb)	MCL (ppb)
Well RFR-10, located at 25490 Old Fredericksburg Road			
6/4/12	Tetrachloroethene (PCE)	25.80M	5
	Trichloroethene (TCE)	14.24	5
	cis-1,2-Dichloroethene (DCE)	0.49F	70

*The "F" qualifier indicates the value is above the laboratory method detection limit, but below the laboratory reporting limit for the compound.

Based on the analytical data, levels of the VOC PCE, TCE, and *cis*-1,2-DCE were identified in the water sample from your well before granular activated carbon (GAC) filtration. Results from the laboratory analysis are provided as an attachment for the above sampling event. The concentrations reported for the VOCs PCE and TCE were above the MCL in the past. Therefore, a filtration system has been installed on your well.

The filtration system was installed by Carbonair Environmental Systems of San Marcos, Texas. The system will remain in operation for the foreseeable future or until significant reductions in contamination levels are seen in the water in your well before it enters the filtration system. As we discussed at the time of installation, CSSA will continue to be responsible for all costs associated with operation and maintenance of this system. CSSA will continue to send a representative every 3 weeks to exchange the five-micron pre-and post-filters in the system.


Carbonair exchanged the first carbon canister and performed other routine maintenance on your system in July 2012. If you experience any problems with the system, please let the installer or CSSA know immediately. Carbonair is very responsive and can make additional

maintenance visits if needed. Post-GAC samples were not collected this event but are scheduled to be collected again during the September 2012 sampling event.

As part of the ongoing CSSA environmental program, we are continuing to investigate and cleanup VOC source areas on the installation and to track these compounds in groundwater on- and off-post. As part of this effort, your well is scheduled to be sampled again in September 2012.

Again, we would like to thank you for your cooperation. We regret that your well has been impacted, but remain committed to making sure your water is safe to use and keeping you informed. If you have any questions concerning this letter, please contact Gabriel Moreno-Fergusson, Environmental Program Manager, at (210) 295-7014.

Sincerely,

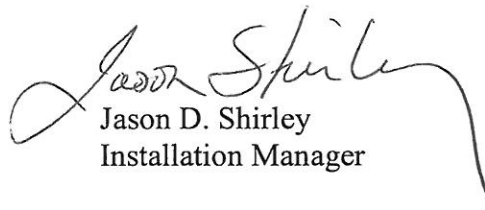

Jason D. Shirley
Installation Manager

Enclosure

cc: Mr. Greg Lyssy, EPA Region 6
Mr. Kirk Coulter, TCEQ Central Office
Mr. Henry Karnei, TCEQ Region 13
Ms. Kyle Cunningham, San Antonio Metropolitan Health Dist.
Ms. Julie Burdey, Parsons

AFCEE
ORGANIC ANALYSES DATA SHEET 2
RESULTS

Analytical Method: EPA 8260B Preparatory Method: 5030B AAB #: 120606AN-167734
Lab Name: APPL, Inc Contract #: *G012
Field Sample ID: RFR-10 Lab Sample ID: AY62951 Matrix: Water
% Solids: NA Initial Calibration ID: N120602
Date Received: 05-Jun-12 Date Prepared: 06-Jun-12 Date Analyzed: 06-Jun-12
Concentration Units: ug/L

Analyte	MDL	RL	Concentration	Dilution	Confirm	Qualifier
1,1-DCE	0.12	1.2	0.12	1		U
CIS-1,2-DCE	0.07	1.2	0.49	1		F
TCE	0.05	1.0	14.24	1		M
TETRACHLOROETHENE	0.06	1.4	25.80	1		M
TRANS-1,2-DCE	0.08	0.6	0.08	1		U
VINYL CHLORIDE	0.08	1.1	0.08	1		U

* TC 7/3/12

Surrogate	Recovery	Control Limits	Qualifier
SURROGATE: 1,2-DICHLOROETHANE-	101	69-139	
SURROGATE: 4-BROMOFLUOROBENZ	104	75-125	
SURROGATE: DIBROMOFLUOROMETH	104	75-125	
SURROGATE: TOLUENE-D8 (S)	98.9	75-125	

Internal Std	Qualifier
1,4-DICHLOROBENZENE-D4 (IS)	
CHLOROBENZENE-D5 (IS)	
FLUOROBENZENE (IS)	

Comments: M = Matrix effect. "M" flagged result is useable and defensible. It only means there was possible interference from the sample itself.
ARF: 67960

AFCEE FORM O-2

* = M flag was removed by Parsons' data validator due to minor QC non-compliant result in the matrix spike analysis. TC 7/3/12